

**Issue Date**

May 15, 2017

Applicable Products

MS3Pro Ultimate Engine Control Units shipped before April 28, 2017

Description

In some installations, the ECU may experience a transient surge on the incoming 12-Volt supply that greatly exceeds the ratings of the power supply, thereby causing internal voltages to permanently deviate from the design specifications.

Condition of Concern

In the case of excessive transient, the fuel injector pulse-width will increase by 1-2 milliseconds resulting in an excessively rich fueling condition.

Correction of Condition

Components will be added and/or interchanged to allow transients of greater magnitude to be sufficiently clamped.

In the event of a suspected failure, please contact support@ampefi.com to receive an RMA number and return instructions. Your ECU will then be promptly repaired, upgraded, and returned.